

# Proposed Rules

Federal Register

Vol. 83, No. 117

Monday, June 18, 2018

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2018-0422; Product Identifier 2018-CE-015-AD]

RIN 2120-AA64

#### Airworthiness Directives; Pacific Aerospace Limited Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to supersede Airworthiness Directive (AD) 2015-23-03 for Pacific Aerospace Limited Model 750XL airplanes. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as fatigue cracks on the fin forward pickup plates. We are issuing this proposed AD to require actions to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by August 2, 2018.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Pacific Aerospace Limited, Airport Road, Hamilton, Private Bag 3027, Hamilton 3240, New Zealand; phone: +64 7843 6144; fax: +64 843 6134; email: [pacific@aerospace.co.nz](mailto:pacific@aerospace.co.nz); internet: [www.aerospace.co.nz](http://www.aerospace.co.nz). You may review copies of the referenced service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

#### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0422; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2018-0422; Product Identifier 2018-CE-015-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each

substantive verbal contact we receive about this proposed AD.

#### Discussion

We issued AD 2015-23-03, Amendment 39-18319 (80 FR 69569; November 10, 2015) ("AD 2015-23-03"). That AD required actions intended to address an unsafe condition on Pacific Aerospace Limited Model 750XL airplanes and was based on mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country.

Since we issued AD 2015-23-03, a new part number (P/N) hi-lok fastener has become available due to limited availability of the original hi-lok P/N.

The Civil Aviation Authority of New Zealand (CAA), has issued DCA/750XL/18B, dated February 28, 2018 (referred to after this as "the MCAI"), to correct an unsafe condition for Pacific Aerospace Limited Model 750XL airplanes. The MCAI states:

This (CAA) AD revised to introduce Pacific Aerospace Limited Mandatory Service Bulletin (MSB) PACSB/XL/068 issue 6, dated 8 January 2018. The changes to the SB are limited to minor editorial changes, and the addition of alternate P/N hi-lok fasteners due to limited availability of the original P/N. There are no changes to the AD applicability or the requirements.

You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0422.

#### Related Service Information Under 14 CFR Part 39

Pacific Aerospace Limited has issued Pacific Aerospace Service Bulletin PACSB/XL/068, Issue 6, dated January 8, 2018. The service information describes procedures for reducing the torque setting for the fin forward pickup bolt. The service bulletin also introduces a new, improved replacement fin forward pickup plate, part number (P/N) 11-0375-1, to replace P/N 11-10281-1. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### FAA's Determination and Requirements of the Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation

in the United States. Pursuant to our bilateral agreement with this State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Costs of Compliance

We estimate that this AD will affect 22 products of U.S. registry. We also estimate that it will take about 22 work-hours per product to comply with all the requirements of this AD. The average labor rate is \$85 per work-hour. Required parts will cost about \$1,692 per product.

Based on these figures, we estimate the cost of this AD on U.S. operators to be \$78,364, or \$3,562 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to small airplanes, gliders, balloons, airships, domestic business jet transport airplanes, and associated products to the Director of the Policy and Innovation Division.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This

proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a "significant regulatory action" under Executive Order 12866,  
 (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by removing Amendment 39–18319 (80 FR 69569; November 10, 2015), and adding the following new AD:

**Pacific Aerospace Limited:** Docket No. FAA–2018–0422; Product Identifier 2018–CE–015–AD.

##### (a) Comments Due Date

We must receive comments by August 2, 2018.

##### (b) Affected ADs

This AD replaces AD 2015–23–03, Amendment 39–18319 (80 FR 69569; November 10, 2015) ("AD 2015–23–03").

##### (c) Applicability

This AD applies to Pacific Aerospace Limited Model 750XL airplanes, all serial numbers through XL–193, XL–195, and XL–197, certificated in any category.

##### (d) Subject

Air Transport Association of America (ATA) Code 53: Fuselage.

##### (e) Reason

This AD was prompted by mandatory continuing airworthiness information (MCAI)

originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as fatigue cracks on the fin forward pickup plates. We are issuing this AD to detect and correct cracked fin forward pickup plates to prevent failure of the fin forward pickup plates, which could result in reduced control.

#### (f) Actions and Compliance

Unless already done, do the actions in paragraphs (f)(1) through (f)(4) of this AD:

(1) Within the next 150 hours time-in-service (TIS) after the effective date of this AD, reduce the fin forward pickup bolt torque following the procedures in section 1.D., paragraphs A. 1) and A. 2) of the PLANNING INFORMATION in Pacific Aerospace Limited Mandatory Service Bulletin PACSB/XL/068, Issue 6, dated January 8, 2018.

(2) At or before reaching 2,000 hours total time-in-service (TTIS) or within the next 150 hours TIS after the effective date of this AD, whichever occurs later, and repetitively thereafter at intervals not to exceed 600 hours TIS or 12 months, whichever occurs first, do a detailed visual inspection and liquid penetrant inspection of the fin forward pickup plates for any evidence of cracking. Do the inspections following the procedures in sections 2.A. and 2.B. of the ACCOMPLISHMENT INSTRUCTIONS in Pacific Aerospace Limited Mandatory Service Bulletin PACSB/XL/068, Issue 6, dated January 8, 2018.

(3) If cracks are found in either of the forward pickup plates during any inspection required in paragraph (f)(2) of this AD, before further flight, replace both fin forward pickup plates with new fin forward pickup plates, part number (P/N) 11–03375–1. Do the replacement following the procedures in section 2.C. of the ACCOMPLISHMENT INSTRUCTIONS in Pacific Aerospace Limited Mandatory Service Bulletin PACSB/XL/068, Issue 6, dated January 8, 2018. This replacement terminates the repetitive inspections required in paragraph (f)(2) of this AD.

(4) If no cracks are found during any inspection required in paragraph (f)(2) of this AD, at or before reaching 6,000 hours TTIS or within the next 600 hours TIS after the effective date of this AD, whichever occurs later, replace both fin forward pickup plates, P/N 11–10281–1, with P/N 11–03375–1. Do the replacement following the procedures in section 2.C or 2.D. of the ACCOMPLISHMENT INSTRUCTIONS in Pacific Aerospace Limited Mandatory Service Bulletin PACSB/XL/068, Issue 6, dated January 8, 2018. This replacement terminates the repetitive inspections required in paragraph (f)(2) of this AD.

#### (g) Credit for Previous Actions

This AD allows credit for actions required in paragraphs (f)(1) through (4) of this AD if done before the effective date of this AD following Pacific Aerospace Limited Mandatory Service Bulletin PACSB/XL/068, Issue 5, dated June 29, 2015.

**(h) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Small Airplane Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, Standards Office, FAA; or the Civil Aviation Authority of New Zealand (CAA).

**(i) Special Flight Permit**

A special flight permit is prohibited until Part A of the ACCOMPLISHMENT INSTRUCTIONS in Pacific Aerospace Limited Mandatory Service Bulletin PACSB/XL/068, Issue 6, dated January 8, 2018, is completed. Once Part A has been completed, a special flight permit is allowed for Part B of the ACCOMPLISHMENT INSTRUCTIONS in Pacific Aerospace Limited Mandatory Service Bulletin PACSB/XL/068, Issue 6, dated January 8, 2018.

**(j) Related Information**

Refer to MCAI CAA AD DCA/750XL/18B, dated February 28, 2018, for related information. You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0422. For service information related to this AD, contact Pacific Aerospace Limited, Airport Road, Hamilton, Private Bag 3027, Hamilton 3240, New Zealand; phone: +64 7843 6144; fax: +64 843 6134; email: [pacific@aerospace.co.nz](mailto:pacific@aerospace.co.nz); internet: [www.aerospace.co.nz](http://www.aerospace.co.nz).

You may review this referenced service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Issued in Kansas City, Missouri, on May 7, 2018.

**Melvin J. Johnson,**

*Deputy Director, Policy & Innovation Division, Aircraft Certification Service.*

[FR Doc. 2018-12886 Filed 6-15-18; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF HOMELAND SECURITY****Coast Guard****33 CFR Part 100**

**[Docket Number USCG-2018-0580]**

**RIN 100-AA08**

**Special Local Regulations; Annual Les Cheneaux Islands Antique Wooden Boat Show; Hessel, MI**

**AGENCY:** Coast Guard, DHS.

**ACTION:** Notice of proposed rulemaking.

**SUMMARY:** The Coast Guard proposes to add a special local regulation to increase safety in the navigable waters of Marquette Bay, Hessel, MI, during the annual Les Cheneaux Islands Antique Wooden Boat Show. The proposal will add a no wake zone to be enforced in the area around the show from 7 a.m. to 7 p.m. on a date in mid-August. We invite your comments on this proposed rulemaking.

**DATES:** Comments and related material must be received by the Coast Guard on or before July 9, 2018.

**ADDRESSES:** You may submit comments identified by docket number USCG-2018-0580 using the Federal eRulemaking Portal at <http://www.regulations.gov>. Type the docket number (USCG-2018-0580) in the "SEARCH" box and click "SEARCH." See the "Public Participation and Request for Comments" portion of the **SUPPLEMENTARY INFORMATION** section for further instructions on submitting comments.

**FOR FURTHER INFORMATION CONTACT:** If you have questions on this rule, call or email Chief Steven Durden, Waterways Management, Coast Guard Sector Sault Sainte Marie, U.S. Coast Guard; telephone 906-635-3222, email [Steven.E.Durden@uscg.mil](mailto:Steven.E.Durden@uscg.mil).

**SUPPLEMENTARY INFORMATION:****I. Table of Abbreviations**

CFR Code of Federal Regulations  
COTP Captain of the Port  
DHS Department of Homeland Security  
FR Federal Register  
NPRM Notice of proposed rulemaking  
§ Section  
U.S.C. United States Code

**II. Background, Purpose, and Legal Basis**

The Les Cheneaux Antique Wooden Boat Show was founded in 1978 and the event is held every year in mid-August. During this event, a variety of vessel traffic is attracted to the area in and surrounding the Hessel Marina. A

commercial ferry vessel, jet skis, kayaks, paddle boards, sail and power vessels all use this waterway to view the show and to transit the area. This mix of vessels in close proximity to each other warrants additional safety measures.

The legal basis for this proposed rulemaking is found at 33 U.S.C. 1233; 33 CFR 1.05-1; Department of Homeland Security Delegation No. 0170.1.

**III. Discussion of Proposed Rule**

The Captain of the Port Sault Sainte Marie (COTP) has determined that adding the Annual Les Cheneaux Islands Antique Wooden Boat Show to the list of Special Local Regulations to establish a no wake zone in the navigable waters of Marquette Bay near Hessel, MI is the most practical way to ensure the safety of the boating public.

**IV. Regulatory Analyses**

We developed this proposed rule after considering numerous statutes and Executive Orders related to rulemaking. Below we summarize our analyses based on a number of these statutes and Executive Orders, and we discuss First Amendment rights of protestors.

**A. Regulatory Planning and Review**

Executive Orders 12866 and 13563 direct agencies to assess the costs and benefits of available regulatory alternatives and, if regulation is necessary, to select regulatory approaches that maximize net benefits. Executive Order 13771 directs agencies to control regulatory costs through a budgeting process. This NPRM has not been designated a "significant regulatory action," under Executive Order 12866. Accordingly, the NPRM has not been reviewed by the Office of Management and Budget (OMB), and pursuant to OMB guidance it is exempt from the requirements of Executive Order 13771.

This regulatory action determination is based on the size, location, duration, and time-of-day for the no wake zone. Vessel traffic will be able to safely transit through the no wake zone which will impact a small designated area within the COTP zone for a short duration of time. Moreover, the Coast Guard will issue Broadcast Notice to Mariners via VHF-FM marine channel 16 about the zone.

**B. Impact on Small Entities**

The Regulatory Flexibility Act of 1980, 5 U.S.C. 601-612, as amended, requires Federal agencies to consider the potential impact of regulations on small entities during rulemaking. The