

The incorporation by reference was approved previously by the Director of the Federal Register as of April 10, 1998 (63 FR 11106, March 6, 1998). Copies may be obtained from Galaxy Aerospace Corporation, One Galaxy Way, Fort Worth Alliance Airport, Fort Worth, Texas 76177. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., Suite 700, Washington, DC.

Note 3: The subject of this AD is addressed in Israeli airworthiness directive 27-97-09-02, dated September 4, 1997.

(g) This amendment becomes effective on November 3, 1998.

Issued in Renton, Washington, on September 21, 1998.

Darrell M. Pederson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 98-25776 Filed 9-28-98; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 98-CE-17-AD; Amendment 39-10806; AD 98-20-38]

RIN 2120-AA64

Airworthiness Directives; Raytheon Aircraft Company 200 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD) that applies to Raytheon Aircraft Company (Raytheon 200 series airplanes. This AD requires revising the FAA-approved Airplane Flight Manual (AFM) to specify procedures that would prohibit flight in severe icing conditions (as determined by certain visual cues), limit or prohibit the use of various flight control devices while in severe icing conditions, and provide the flight crew with recognition cues for, and procedures for exiting from, severe icing conditions. This AD was prompted by the results of a review of the requirements for certification of these airplanes in icing conditions, new information on the icing environment, and icing data provided currently to the flight crew. The actions specified by this AD are intended to minimize the potential hazards associated with operating these airplanes in severe icing conditions by providing more clearly defined procedures and limitations associated with such conditions.

EFFECTIVE DATE: November 4, 1998.

FOR FURTHER INFORMATION CONTACT: Mr. John P. Dow, Sr., Aerospace Engineer, Small Airplane Directorate, Aircraft Certification Service, 1201 Walnut, suite 900, Kansas City, Missouri 64106, telephone: (816) 426-6932; facsimile: (816) 426-2169.

SUPPLEMENTARY INFORMATION:

Events Leading to the Issuance of This AD

A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an AD that would apply to Raytheon 200 series airplanes was published in the **Federal Register** as a notice of proposed rulemaking (NPRM) on June 8, 1998 (63 FR 31131). The NPRM proposed to require revising the Limitations Section of the FAA-approved AFM to specify procedures that would:

- Require flight crews to immediately request priority handling from Air Traffic Control to exit severe icing conditions (as determined by certain visual cues);
- Prohibit use of the autopilot when ice is formed aft of the protected surfaces of the wing, or when an unusual lateral trim condition exists; and
- Require that all icing wing inspection lights be operative prior to flight into known or forecast icing conditions at night.

This proposed AD would also require revising the Normal Procedures Section of the FAA-approved AFM to specify procedures that would:

- Limit the use of the flaps and prohibit the use of the autopilot when ice is observed forming aft of the protected surfaces of the wing, or if unusual lateral trim requirements or autopilot trim warnings are encountered; and
- Provide the flight crew with recognition cues for, and procedures for exiting from, severe icing conditions.

The NPRM was the result of a review of the requirements for certification of these airplanes in icing conditions, new information on the icing environment, and icing data provided currently to the flight crew.

Interested persons have been afforded an opportunity to participate in the making of this amendment. Due consideration has been given to the comment received on the proposal.

Comment Disposition

The commenter proposes that the FAA change the proposal to require revising the Abnormal or Emergency Procedures section of the AFM instead of the Normal Procedures section of the AD. The commenter states that, since

the Raytheon 200 series airplanes are not certificated for operation in icing conditions, operation outside of the airplanes certificated limits would be an abnormal condition.

The FAA concurs. For previous AD's concerning this subject on other airplane models, the FAA has approved alternative methods of compliance to allow the owners/operators the option of revising the Abnormal Procedures Section or Emergency Procedures Section of the AFM, or the Normal Procedures section of the AFM. The FAA will change the final rule to include the provision of revising the Abnormal Procedures or Emergency Procedures Section of the AFM as an AMOC to the requirement of revising the Normal Procedures Section of the AFM.

The FAA's Determination

After careful review of all available information related to the subject presented above, the FAA has determined that air safety and the public interest require the adoption of the rule as proposed except for addition of the above-referenced AMOC and minor editorial corrections. The FAA has determined that this addition and these minor corrections will not change the meaning of the AD and will not add any additional burden upon the public than was already proposed.

Cost Impact

The FAA estimates that 1,600 airplanes in the U.S. registry will be affected by this AD, that it will take approximately 1 workhour per airplane to accomplish this action, and that the average labor rate is approximately \$60 an hour. Since an owner/operator who holds at least a private pilot's certificate as authorized by §§ 43.7 and 43.9 of the Federal Aviation Regulations (14 CFR 43.7 and 43.9) can accomplish this action, the only cost impact upon the public is the time it will take the affected airplane owners/operators to incorporate this AFM revision.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator will accomplish those actions in the future if this AD were not adopted.

In addition, the FAA recognizes that this action may impose operational costs. However, these costs are incalculable because the frequency of occurrence of the specified conditions and the associated additional flight time cannot be determined. Nevertheless, because of the severity of the unsafe condition, the FAA has determined that

continued operational safety necessitates the imposition of the costs.

Regulatory Impact

The regulations adopted herein will not have substantial direct effects on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, in accordance with Executive Order 12612, it is determined that this final rule does not have sufficient federalism implications to warrant the preparation of a Federalism Assessment.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the final evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption ADDRESSES.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding a new airworthiness directive (AD) to read as follows:

98-20-38 Raytheon Aircraft Company:

Amendment 39-10806; Docket No. 98-CE-17-AD.

Applicability: The following airplane models, all serial numbers, certificated in any category.

Models

200 (A100-1 (U-21J)); 200C; 200CT; 200T; A200 (C-12A) or (C-12C); A200C (UC-12B); A200CT (C-12D), (FWC-12D), (RC-12D), (C-12F), (RC-12G), (RC-12H), (RC-12K), or (RC-12P); B200; B200C (C-12F), (UC-12F), (UC-12M), or (C-12R); B200CT; and B200T.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (e) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated in the body of this AD, unless already accomplished.

To minimize the potential hazards associated with operating the airplane in severe icing conditions by providing more clearly defined procedures and limitations associated with such conditions, accomplish the following:

(a) Within 30 days after the effective date of this AD, accomplish the requirements of paragraphs (a)(1) and (a)(2) of this AD.

Note 2: Operators should initiate action to notify and ensure that flight crewmembers are apprised of this change.

(1) Revise the FAA-approved Airplane Flight Manual (AFM) by incorporating the following into the Limitations Section of the AFM. This may be accomplished by inserting a copy of this AD in the AFM.

"Warning

Severe icing may result from environmental conditions outside of those for which the airplane is certificated. Flight in freezing rain, freezing drizzle, or mixed icing conditions (supercooled liquid water and ice crystals) may result in ice build-up on protected surfaces exceeding the capability of the ice protection system, or may result in ice forming aft of the protected surfaces. This ice may not be shed using the ice protection systems, and may seriously degrade the performance and controllability of the airplane.

- During flight, severe icing conditions that exceed those for which the airplane is certificated shall be determined by the following visual cues. If one or more of these visual cues exists, immediately request priority handling from Air Traffic Control to facilitate a route or an altitude change to exit the icing conditions.

- Unusually extensive ice accumulation on the airframe and windshield in areas not normally observed to collect ice.

- Accumulation of ice on the upper surface of the wing, aft of the protected area.

- Accumulation of ice on the engine nacelles and propeller spinners farther aft than normally observed.

- Since the autopilot, when installed and operating, may mask tactile cues that indicate adverse changes in handling characteristics, use of the autopilot is prohibited when any of the visual cues specified above exist, or when unusual lateral trim requirements or autopilot trim warnings are encountered while the airplane is in icing conditions.

- All wing icing inspection lights must be operative prior to flight into known or forecast icing conditions at night. [NOTE: This supersedes any relief provided by the Master Minimum Equipment List (MMEL).]

- (2) Revise the FAA-approved AFM by incorporating the following into the Normal Procedures Section of the AFM. This may be accomplished by inserting a copy of this AD in the AFM.

"The Following Weather Conditions May Be Conducive to Severe In-Flight Icing

- Visible rain at temperatures below 0 degrees Celsius ambient air temperature.
- Droplets that splash or splatter on impact at temperatures below 0 degrees Celsius ambient air temperature.

Procedures for Exiting the Severe Icing Environment

These procedures are applicable to all flight phases from takeoff to landing. Monitor the ambient air temperature. While severe icing may form at temperatures as cold as -18 degrees Celsius, increased vigilance is warranted at temperatures around freezing with visible moisture present. If the visual cues specified in the Limitations Section of the AFM for identifying severe icing conditions are observed, accomplish the following:

- Immediately request priority handling from Air Traffic Control to facilitate a route or an altitude change to exit the severe icing conditions in order to avoid extended exposure to flight conditions more severe than those for which the airplane has been certificated.

- Avoid abrupt and excessive maneuvering that may exacerbate control difficulties.

- Do not engage the autopilot.
- If the autopilot is engaged, hold the control wheel firmly and disengage the autopilot.

- If an unusual roll response or uncommanded roll control movement is observed, reduce the angle-of-attack.
- Do not extend flaps when holding in icing conditions. Operation with flaps extended can result in a reduced wing angle-of-attack, with the possibility of ice forming on the upper surface further aft on the wing than normal, possibly aft of the protected area.

- If the flaps are extended, do not retract them until the airframe is clear of ice.

- Report these weather conditions to Air Traffic Control."

- (b) As an alternative method of compliance to the actions required by paragraph (a)(2) of this AD, revise the Abnormal Procedures Section or Emergency Procedures Section of the AFM instead of the Normal Procedures section of the AFM. Insert the information presented in paragraph (a)(2) of this AD into the applicable AFM section.

- (c) Incorporating the AFM revisions, as required by this AD, may be performed by the owner/operator holding at least a private pilot certificate as authorized by section 43.7 of the Federal Aviation Regulations (14 CFR 43.7), and must be entered into the aircraft records showing compliance with this AD in accordance with section 43.9 of the Federal Aviation Regulations (14 CFR 43.9).

(d) Special flight permits may be issued in accordance with §§ 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

(e) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Small Airplane Directorate, FAA, 1201 Walnut, suite 900, Kansas City, Missouri 64106. The request shall be forwarded through an appropriate FAA Maintenance Inspector, who may add comments and then send it to the Manager, Small Airplane Directorate.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Small Airplane Directorate.

(f) All persons affected by this directive may examine information related to this AD at the FAA, Central Region, Office of the Regional Counsel, Room 1558, 601 E. 12th Street, Kansas City, Missouri 64106.

(g) This amendment becomes effective on November 4, 1998.

Issued in Kansas City, Missouri, on September 22, 1998.

James E. Jackson,

Acting Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 98-25955 Filed 9-28-98; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Airspace Docket No. 98-ACE-38]

Amendment to Class E Airspace; Trenton, MO

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Direct final rule; request for comments.

SUMMARY: This action amends the Class E airspace area at Trenton Municipal Airport, Trenton, MO. The FAA has developed Global Positioning System (GPS) Runway (RWY) 18 and RWY 36 Standard Instrument Approach Procedures (SIAPs) to serve Trenton Municipal Airport, MO. Additional controlled airspace extending upward from 700 feet Above Ground Level (AGL) is needed to accommodate these SIAPs and for Instrument Flight Rules (IFR) operations at this airport. The enlarged area will contain the new GPS RWY 18 and GPS RWY 36 SIAPs in controlled airspace. The intended effect of this rule is to provide controlled Class E airspace for aircraft executing the GPS RWY 18 and GPS RWY 36

SIAPs and to segregate aircraft using instrument approach procedures in instrument conditions from aircraft operating in visual conditions.

DATES: This direct final rule is effective on 0901 UTC, January 28, 1999.

Comments for inclusion in the Rules Docket must be received on or before November 15, 1998.

ADDRESSES: Send comments regarding the rule in triplicate to: Manager, Airspace Branch, Air Traffic Division, ACE-520, Federal Aviation Administration, Docket Number 98-ACE-38, 601 East 12th Street, Kansas City, MO 64106.

The official docket may be examined in the Office of the Regional Counsel for the Central Region at the same address between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays.

An informal docket may also be examined during normal business hours in the Air Traffic Division at the same address listed above.

FOR FURTHER INFORMATION CONTACT: Kathy Randolph, Air Traffic Division, Airspace Branch, ACE-520C, Federal Aviation Administration, 601 East 12th Street, Kansas City, MO 64106; telephone: (816) 426-3408.

SUPPLEMENTARY INFORMATION: The FAA has developed GPS RWY 18 and GPS RWY 36 SIAPs to serve the Trenton Municipal Airport, Trenton, MO. The amendment to Class E airspace at Trenton, MO, will provide additional controlled airspace at and above 700 feet AGL in order to contain the new SIAPs within controlled airspace, and thereby facilitate separation of aircraft operating under Instrument Flight Rules. The area will be depicted on appropriate aeronautical charts. Class E airspace areas extending upward from 700 feet or more above the surface of the earth are published in paragraph 6005 of FAA Order 7400.9F, dated September 10, 1998, and effective September 16, 1998, which is incorporated by reference in 14 CFR 71.1. The Class E airspace designation listed in this document will be published subsequently in the Order.

The Direct Final Rule Procedure

The FAA anticipates that this regulation will not result in adverse or negative comment and, therefore, is issuing it as a direct final rule. Previous actions of this nature have not been controversial and have not resulted in adverse comments or objections. The amendment will enhance safety for all flight operations by designating an area where VFR pilots may anticipate the presence of IFR aircraft at lower

altitudes, especially during inclement weather conditions. A greater degree of safety is achieved by depicting the area on aeronautical charts. Unless a written adverse or negative comment, or a written notice of intent to submit an adverse or negative comment is received within the comment period, the regulation will become effective on the date specified above. After the close of the comment period, the FAA will publish a document in the **Federal Register** indicating that no adverse or negative comments were received and confirming the date on which the final rule will become effective. If the FAA does receive, within the comment period, an adverse or negative comment, or written notice of intent to submit such a comment, a document withdrawing the direct final rule will be published in the **Federal Register**, and a notice of proposed rulemaking may be published with a new comment period.

Comments Invited

Although this action is in the form of a final rule and was not preceded by a notice of proposed rulemaking, comments are invited on this rule. Interested persons are invited to comment on this rule by submitting such written data, views, or arguments as they may desire. Communications should identify the Rules Docket number and be submitted in triplicate to the address specified under the caption **ADDRESSES**. All communications received on or before the closing date for comments will be considered, and this rule may be amended or withdrawn in light of the comments received. Factual information that supports the commenter's ideas and suggestions is extremely helpful in evaluating the effectiveness of this action and determining whether additional rulemaking action would be needed.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy-related aspects of the rule that might suggest a need to modify the rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report that summarizes each FAA-public contact concerned with the substance of this action will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this rule must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket No. 98-ACE-38." The postcard will be date stamped and returned to the commenter.